

MONUMENT RECORD

Corner I.D. #


~~R-37~~ R-13

STATE OF INDIANA - COUNTY OF MONROE

Section Fourteen (14), Township 9 North, Range 1 East

Monument Description & Remarks: Stone w/"x" found at S 1/4 mile of SW 1/4.
Stone was 4" x 8" x 1" out of ground. Corner witnessed 6/29/89. See
attached notes.

Recovery Tie Drawing

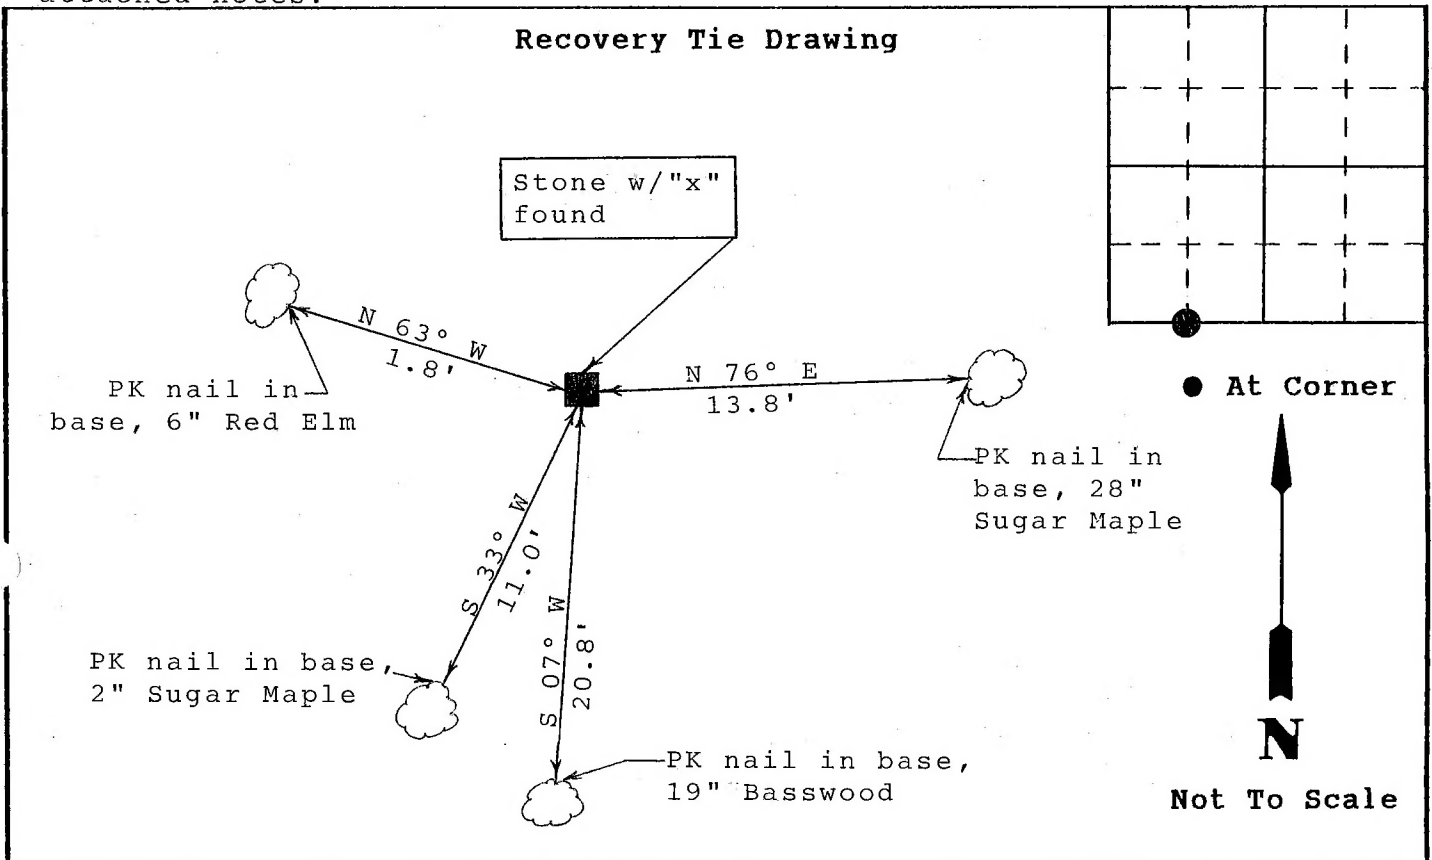

State of Indiana

County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify
 that this document was prepared under my direction in
 accordance with the provisions of Section 17-3-64-4
 through 17-3-64-8 of the Indiana Code, being Acts of 1965,
 Chapter 319; and the above data is given under my hand and
 seal this 1st day of February, 1995 A.D.

Space
 Reserved For
 Recording
 Officer

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest

United States Government Agency

Darrell Breedlove, Timber Specialist

Title

Field Book:

n/a

Page:

n/a


SECTION 14, T 9 N, R 1 E

rebar (see 3f)

1. On 6/26/87, the west line of the E $\frac{1}{2}$, NW $\frac{1}{4}$ was ran by compassing north from a pipe found at the SW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$. A stone was located at the NW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$ and it was witnessed as follows:

| | <u>Az°</u> | <u>Species</u> | <u>DBH</u> | <u>Distance</u> |
|-------|------------|------------------|------------|-----------------|
| 46°-W | 224 | Shagbark Hickory | 18" | 20.1' |
| 62°-E | 062 | Am. Beech | 23" | 22.8' |
| 26°-E | 026 | Am. Beech | 14" | 15.9' |


The bearing between the two markers is N 0.8E at 1°W declination. Plastic signs were posted at the stone.



Darrell Breedlove

Timber Specialist

2. On August 17, 1988, a steel fence post was driven next to the stone at NW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$, Sec. 14.



Darrell Breedlove

Timber Specialist

- 3a) On June 29, 1989, the South $\frac{1}{4}$ mile stone of the SW $\frac{1}{4}$, Sec. 14, T9N, R1E was witnessed as follows:

PK nails were driven at the bases of these trees:

| | <u>AZ</u> | <u>Spp.</u> | <u>DBH(in)</u> | <u>Distance(ft)</u> | <u>Comment</u> | |
|---------|-----------|-------------|----------------|---------------------|---------------------------|---|
| N-76°-E | 076° | Sugar Maple | 28 | 13.8 | Hollow w/wire | 3 |
| S-07°-W | 187 | Basswood | 19 | 20.8 | w/wire | |
| S-33°-W | 213 | Sugar Maple | 2 | 11.0 | | |
| N-63°-W | 297 | Red Elm | 6 | 1.8 | Dead tree in fence corner | |

This stone has an "x" and measures 4"x8"x1"(h). It is S 0.9°E (1°W) from the SW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$, Sec. 14 (see 3b).

- b) On June 30, 1989, the SW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$, Sec. 14 was witnessed as follows: PK nails were driven at the bases of the first three trees.

| | <u>AZ</u> | <u>Spp.</u> | <u>DBH(in)</u> | <u>Distance(ft)</u> | <u>Comment</u> |
|---------|-----------|----------------|----------------|---------------------|----------------|
| S-22°-W | 202° | White Oak | 15 | 14.0 | |
| S-34°-W | 304 | Red Oak | 18 | 19.0 | |
| N-05°-W | 355 | Red Maple | 8 | 18.2 | |
| N-61°-E | 61 | American Beech | 2 | 11.8 | Has yellow tag |

this stone is laying on its side, but it has an "x".

- c) Two pipe markers were observed in the vicinity of the center of the SW $\frac{1}{4}$, Sec. 14, but neither marker is on-line between two stones found (see 3a and 3b). A $\frac{1}{2}$ "x10"